

**Three Year Re-Inspection
Pleasantville School District Board of Education**

Building Name/Number

Washington Avenue School	
--------------------------	--

Building Location

225 West Washington Avenue, Pleasantville, NJ	
--	--

Homogeneous ID#	Material	Location	Material Cond.			Total Amt.	Damaged Amt.	Friable	Response Action/Notes
			TYP	DC	PDC				
01	9x9 Tan Floor Tile	Boiler Room Entry Way, Electrical Room, Art Closet, Gym Storage near exit door	M	D	PD	344 SF	15 SF	N	Minor Damage throughout all areas. Boiler Room Entry & Gym Storage – New flooring recommended O&M
02	9x9 Dark Green Floor Tile	Back Entry to Gym	M	D	PD	117 SF	2 SF	N	Minor Cracking – O&M
03	9x9 Light Green Floor Tile	Cafeteria	M	D	PD	513 SF	2 SF	N	Minor Cracking – O&M Near Exit Door – Place several coats of wax to prevent further damage
04	9x9 Beige Streaked Floor Tile	Cafeteria	M	D	PD	513 SF	1 SF	N	Minor Cracking – O&M Near Exit Door – Place several coats of wax to prevent further damage
05	12x12 Various Colored Floor Tile	Throughout Building	M	D	PD	9,563 SF	1 SF	N	Minor Cracking under the bookcase in the Library – O&M
11	Boiler Lagging	Boiler Room	T	ND	PD	875 SF	0	Y	O&M

*Refers to Material Type and Damage Categories

T-Material Type As:	DC-Damage Condition	PD-Potential Damage Categories	**Response Action
S - Surfacing	N - No Damage	NPD - No Potential Damage	Repair
M - Miscellaneous	D - Damage	PD - Potential Damage	Remove
T - Thermal System	SD - Significant	PSD - Potential Significant Damage	Operation & Maintenance
			Encapsulate

Cathy Ladden

Signature of Person Completing Report

Asbestos Inspector - ACC # 0317-6-014

Title of Person Completing Report

**Three Year Re-Inspection
Pleasantville School District Board of Education**

Building Name/Number

Washington Avenue School	
--------------------------	--

Building Location

225 West Washington Avenue, Pleasantville, NJ	
--	--

Homogeneous ID#	Material	Location	Material Cond.			Total Amt.	Damaged Amt.	Friable	Response Action/Notes
			TYP	DC	PDC				
12	Fittings associated with fiberglass pipe insulation	Boiler Room	T	D	PD	15 LF	2 SF	Y	Minor Deterioration on P2 (Pump 2) – O&M
13	Header Pipe Insulation	Boiler Room	T	ND	PD	15 LF	0	Y	O&M
14	Boiler Jacket Insulation	Boiler Room	T	D	PD	1500 sf	2 SF	Y	Minor Damage due to age - Repair
15	Boiler Breeching	Boiler Room	T	D	PD	875 SF	4 SF	Y	Minor Damage due to age – Repair
16	Boiler Packing Insulation (Interior of boilers)	Boiler Room	T	ND	NPD	1500 SF	0	Y	O&M
17	Sprinkler System pipe elbows associated with fiberglass pipe insulation	Boiler Room	T	D	PD	4 lf	1 LF	Y	Minor Damage due to age – Repair

*Refers to Material Type and Damage Categories

T-Material Type As:	DC-Damage Condition	PD-Potential Damage Categories	**Response Action
S - Surfacing	N - No Damage	NPD - No Potential Damage	Repair
M - Miscellaneous	D - Damage	PD - Potential Damage	Remove
T - Thermal System	SD - Significant	PSD - Potential Significant Damage	Operation & Maintenance
			Encapsulate

Cathy Ladden

Signature of Person Completing Report

Asbestos Inspector - ACC # 0317-6-014

Title of Person Completing Report